

AS THE CROW FLIES SIGN COMPANY

www.crowsigns.com


CONTENTS

- 1 Topper (sailboat, golfer, football player, etc.), which screws into the top
- 1 2 ½" Long Tube with 4 holes on the side and 1 hole on the top
- 1 Threaded Pipe Collar with set screw
- 4 Threaded Directional Dowels (north, south, east, west)
- - Directional Arrows (up to 10)
- - 1" Spacers (number of spacers determined by number of Directional Arrows)
- 1 Bearing Collar (similar to spacer but with set screw)
- 1 Pole (1" in diameter 4' 6" in length)
- 1 Pole (1 ½" in diameter 4' 6" in length)
- 1 Base (12" high tube with round base & 3 flanges at top)
- 3 Legs with pad feet
- 6 Nuts & 6 Bolts
- 4 Stakes
- 1 Allen wrench
- 1 Compass



SETUP INSTRUCTIONS

1. Using the 6 Nuts and 6 Bolts, attach the 3 Legs to the flanges of the Base. Loosely tighten bolts. The Leg pads should face downward.
2. Take the Base assembly and push it into the ground until all 3 Legs touch equally. Once in place, tighten all 6 Leg bolts.
3. Pound in Stakes - one into the hole in the pad of each Leg. The fourth Stake goes into any one of the three holes on the round Base.
4. Insert 1 ½" diameter Pole into the Base (make certain the 2 set screws in the pole are at the top when inserting into the base) Securely tighten the Base set screw with allen wrench.
5. Take the 1" diameter Pole and slide the Bearing Collar with set screw down to where the arrows will nest. Securely tighten the Bearing Collar set screw with allen wrench. You are now ready to slide the Directional Arrows onto the pole.
6. Slide the first Directional Arrow in place. Take a 1" Spacer and slide it into place alternating arrows and spacers until done.
7. Take the Threaded Pipe Collar with set screw, slide it onto pole making sure that the set screw is at the top (there is also a hole at the bottom of the Threaded Pipe Collar). Let it touch the top arrow and loosely tighten the set screw with allen wrench.
8. Take the 2 ½" Long Tube with 4 holes on the side and 1 hole on the top and screw the Threaded Directional Dowels into the appropriate side holes (north, south, east, & west). Screw the Topper into the top hole. Take this assembly and slide it on top of the pole. Secure it to the pole by tightening the set screw with allen wrench.
9. Pick up pole assembly with arrows, directional dowels, and topper and insert it into the base assembly.
10. Before securing the top pole, rotate the entire pole assembly until the N directional dowel is facing north. Securely tighten the 1 ½" diameter pole's 2 set screws with allen wrench.
11. You are now ready to set the arrows to their proper positions - See attached Arrow Placement Instructions.
12. After properly placing arrows, securely tighten set screw on the Threaded Pipe Collar (the piece at the top of all the arrows) Take the allen wrench, insert it into the bottom hole of the Threaded Pipe Collar and turn the collar clockwise. This will force the collar to push down on arrows and securely hold them in place.

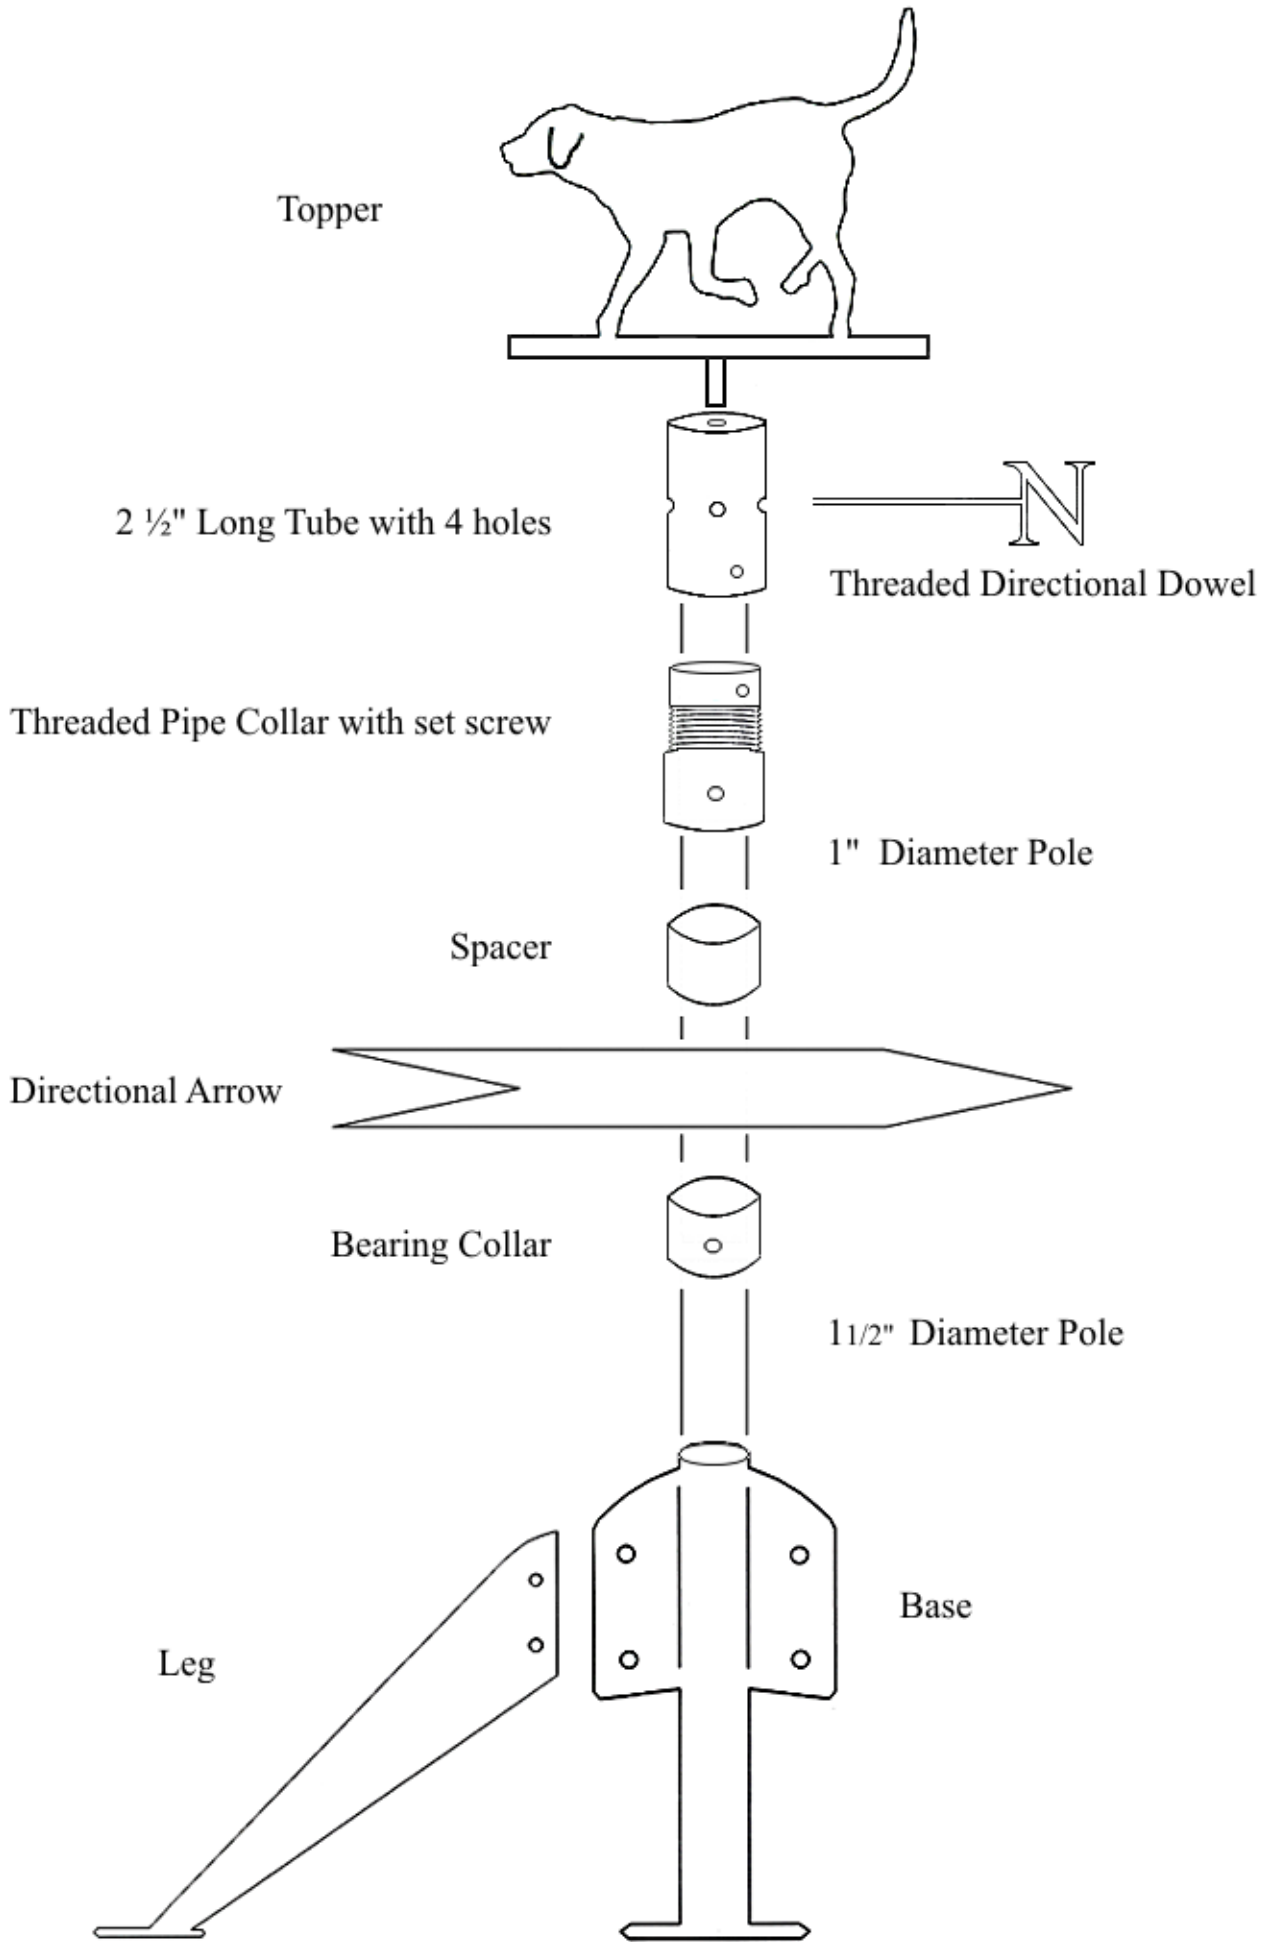

As The Crow Flies Sign Company